

40

Date: Wednesday, 9/12/2007 11:48:53 AM
 User: Kim Johnston

Process Sheet

Customer : CU-DAR001 Dart Helicopters Services Drawing Name : 206L/L/L3/L4 HIGH GEAR SKID
 Job Number : 34560
 Estimate Number : 10525
 P.O. Number :
 This Issue : 9/12/2007 S.O. No. :
 Prsht Rev. : NC Part Number : D206642411
 First Issue : / / Type : LANDING GEAR Drawing Number : N/A
 Previous Run : 34557 Drawing Revision : N/A
 Material :
 Due Date : 10/5/2007 Qty: 1 Um: Each
 Written By :
 Checked & Approved By : 07.09.12
 Comment : Est Rev:K 05.10.11 Revised picklist per CHG004 KJ/CP/JL
 M

Additional Product

Job Number:



Seq. #: Machine Or Operation: Description :

1.0 DC DOCUMENT CONTROL



Comment: DOCUMENT CONTROL

Photocopy bluefile and create labels per PPP D206-642-411 CHG004

07.09.13
 A/C 10/31

2.0 34560A 206 L HIGH GEAR SKIDTUBE



Comment: Sub-Component 206 L HIGH GEAR SKIDTUBE

D206-642-441 B 34134A

3.0 PACKAGING 1 PACKAGING RESOURCE #1



Comment: PACKAGING RESOURCE #1

Pick Packing Kit

4.0 D2652 Bushing



Comment: Qty.: 24.0000 Each(s)/Unit Total: 24.0000 Each(s)

Pick: Packing Kit

Qty Part Number Description Batch

24 D2652 Bushing 534893
 1 D206-642-441(REF) 1534134A

SC

5.0 D2655 Ring



Comment: Qty.: 1.0000 Each(s)/Unit Total: 1.0000 Each(s)

Pick: Packing Kit

Qty Part Number Description Batch

1 D2655 Tow Ring 32988

7/10/30 SC

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

Date: Wednesday, 9/12/2007 11:48:53 AM
User: Kim Johnston

Process Sheet

Customer: CU-DAR001 Dart Helicopters Services

Drawing Name: 206L/L/L3/L4 HIGH GEAR SKID

Job Number: 34560

Part Number: D206642411

Job Number:



Seq. #:

Machine Or Operation:

Description :

6.0

D2659

Lug Assembly



Comment: Qty.: 2.0000 Each(s)/Unit Total : 2.0000 Each(s)

Pick: Packing Kit

Qty Part Number

Description

Batch

2 D2659 Lug Assembly

34076

SP

B-33018

1x

B-33371

1x

7.0

D2712

Set Screw



Comment: Qty.: 10.0000 Each(s)/Unit Total : 10.0000 Each(s)

Pick: Packing Kit

Qty Part Number

Description

Batch

10 D2712

Set Screw

34172

SP

8.0

D29321

206 Saddle Left side



Comment: Qty.: 1.0000 Each(s)/Unit Total : 1.0000 Each(s)

Pick: Packing Kit

Qty Part Number

Description

Batch

1 D2932-1

Saddle

34002

34004

SP

9.0

D29331

206 Saddle Left



Comment: Qty.: 1.0000 Each(s)/Unit Total : 1.0000 Each(s)

Pick: Packing Kit

Qty Part Number

Description

Batch

1 D2933-1

Saddle

34190

SP

10.0

D2934

Saddle Spacer



Comment: Qty.: 2.0000 Each(s)/Unit Total : 2.0000 Each(s)

Pick: Packing Kit

Qty Part Number

Description

Batch

2 D2934

Saddle Spacer

34630

SP

11.0

D2935

Saddle Spacer



Comment: Qty.: 2.0000 Each(s)/Unit Total : 2.0000 Each(s)

Pick: Packing Kit

Qty Part Number

Description

Batch

2 D2935

Saddle Spacer

34174

2/10/31 SP

Dart Aerospace Ltd

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

Date: Wednesday, 9/12/2007 11:48:53 AM
User: Kim Johnston

Process Sheet

Customer: CU-DAR001 Dart Helicopters Services

Drawing Name: 206L/L/L3/L4 HIGH GEAR SKID

Job Number: 34560

Part Number: D206642411

Job Number:



Seq. #:

Machine Or Operation:

Description :

12.0

D29381

206 Saddle Left side



Comment: Qty.: 1.0000 Each(s)/Unit Total : 1.0000 Each(s)

Pick: Packing Kit

Qty Part Number

Description Batch

1 D2938-1

Saddle

333355

SP

13.0

D29391

206 Saddle Left side



Comment: Qty.: 1.0000 Each(s)/Unit Total : 1.0000 Each(s)

Pick: Packing Kit

Qty Part Number

Description Batch

1 D2939-1

Saddle

33361

SP

14.0

D2968043

Tow Ring



Comment: Qty.: 1.0000 Each(s)/Unit Total : 1.0000 Each(s)

Pick: Packing Kit

Qty Part Number

Description Batch

1 D2968-043

Tow Ring

30275

SP 32503 SG

7/10/31

15.0

AN337A

Bolt



Comment: Qty.: 4.0000 Each(s)/Unit Total : 4.0000 Each(s)

Pick: Packing Kit

Qty Part Number

Description Batch

4 AN3-37A

Bolt

M103947

SO

16.0

AN341A

Bolt



Comment: Qty.: 8.0000 Each(s)/Unit Total : 8.0000 Each(s)

Pick: Packing Kit

Qty Part Number

Description Batch

8 AN3-41A

Bolt

M105428

SP

17.0

AN45A

Bolt



Comment: Qty.: 1.0000 Each(s)/Unit Total : 1.0000 Each(s)

Pick: Packing Kit

Qty Part Number

Description Batch

M100857

7/10/31

SP

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

Date: Wednesday, 9/12/2007 11:48:53 AM

User: Kim Johnston

Process Sheet

Customer: CU-DAR001 Dart Helicopters Services

Drawing Name: 206L/L3/L4 HIGH GEAR SKID

Job Number: 34560

Part Number: D206642411

Job Number:



Seq. #:

Machine Or Operation:

Description :

1 AN4-5A

Bolt

18.0

AN46A

Bolt



Comment: Qty.: 12.0000 Each(s)/Unit Total : 12.0000 Each(s)

Pick: Packing Kit

Qty Part Number

Description

Batch

12 AN4-6A

Bolt

M104322

SP

19.0

AN511A

Bolt



Comment: Qty.: 8.0000 Each(s)/Unit Total : 8.0000 Each(s)

Pick: Packing Kit

Qty Part Number

Description

Batch

8 AN5-11A

Bolt

M105810

SP

20.0

AN512A

Bolt



Comment: Qty.: 4.0000 Each(s)/Unit Total : 4.0000 Each(s)

Pick: Packing Kit

Qty Part Number

Description

Batch

4 AN5-12A

Bolt

M104885

SP

21.0

AN513A

Bolt



Comment: Qty.: 4.0000 Each(s)/Unit Total : 4.0000 Each(s)

Pick: Packing Kit

Qty Part Number

Description

Batch

4 AN5-13A

Bolt

M104936

SP

22.0

AN960JD10

Washer



Comment: Qty.: 12.0000 Each(s)/Unit Total : 12.0000 Each(s)

Pick: Packing Kit

Qty Part Number

Description

Batch

+12 AN960JD10

Washer

M100151

7/10/31

SP

Dart Aerospace Ltd

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

Date: Wednesday, 9/12/2007 11:48:53 AM

User: Kim Johnston

Process Sheet

Customer: CU-DAR001 Dart Helicopters Services

Drawing Name: 206L/L3/L4 HIGH GEAR SKID

Job Number: 34560

Part Number: D206642411

Job Number:



Seq. #:

Machine Or Operation:

Description :

23.0

AN960JD1016

Washer



Comment: Qty.: 1.0000 Each(s)/Unit Total : 1.0000 Each(s)

Qty Part Number Description Batch

1 AN960JD1016 Washer 5519 *50*

24.0

AN960JD416

Washer



Comment: Qty.: 25.0000 Each(s)/Unit Total : 25.0000 Each(s)

Qty Part Number Description Batch

f1 25 AN960JD416 Washer M105426 *54*

25.0

AN960JD516

Washer



Comment: Qty.: 8.0000 Each(s)/Unit Total : 8.0000 Each(s)

Qty Part Number Description Batch

8 AN960JD516 Washer M104156 *56*

26.0

AN9704

Washer



Comment: Qty.: 1.0000 Each(s)/Unit Total : 1.0000 Each(s)

Qty Part Number Description Batch

1 AN970-4 Washer M105442 *54*

27.0

MS21042L3

Nut



Comment: Qty.: 12.0000 Each(s)/Unit Total : 12.0000 Each(s)

Qty Part Number Description Batch

f1 12 MS21042L3 Nut (or -3) M104625 *54*

28.0

MS21042L4

Nut



Comment: Qty.: 13.0000 Each(s)/Unit Total : 13.0000 Each(s)

Qty Part Number Description Batch

13 MS21042L4 Nut (or -4) M105054 *8/10/31 54*

Dart Aerospace Ltd

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

Date: Wednesday, 9/12/2007 11:48:53 AM

User: Kim Johnston

Process Sheet

Customer: CU-DAR001 Dart Helicopters Services

Drawing Name: 206L/L3/L4 HIGH GEAR SKID

Job Number: 34560

Part Number: D206642411

Job Number:



Seq. #:

Machine Or Operation:

Description :

29.0

QC4

INSPECT 100% KITS FOR COMPLETENESS



Comment: INSPECT 100% KITS FOR COMPLETENESS

8/10/31

30.0

PACKAGING 1

PACKAGING RESOURCE #1



Comment: PACKAGING RESOURCE #1

Identify and pack for shipping as per PPP D206-642-411

Location:

PPP Rev: D

10/10/31

DS

31.0

QC21

FINAL INSPECTION/W/O RELEASE



Comment: FINAL INSPECTION/W/O RELEASE

07.11.01

Job Completion



C207111101

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

Date: Wednesday, 9/12/2007 11:49:27 AM
User: Kim Johnston

Process Sheet

40

Customer : CU-DAR001 Dart Helicopters Services Drawing Name : 206 L HIGH GEAR SKIDTUBE
Job Number : 34560A
Estimate Number : 10522
P.O. Number : N/A
This Issue : 9/12/2007 S.O. No. : N/A
Prsht Rev. : NC
First Issue : N/A Type : LANDING GEAR
Previous Run : 34557A
Written By :
Checked & Approved By :
Comment : Est Rev. 05.10.11 Added D3429-1 per CHG002 KJ/CP/JL
M

Part Number : D206642441
Drawing Number : D2650 REV E
Project Number : N/A
Drawing Revision : E
Material : N/A
Due Date : 10/5/2007 Qty: 1 Um: Each

Additional Product

Job Number:



Seq. #: Machine Or Operation: Description :

1.0 DC DOCUMENT CONTROL



Comment: DOCUMENT CONTROL

Photocopy bluefile and create labels per PPP D206-642-441 CHG002

N/A

2.0 D2620 Bent 206 Skidtube



Comment: Qty.: 1.0000 Each(s)/Unit Total : 1.0000 Each(s)

Pick:

Qty Part Number

Description

Batch

1 D2620

Bent Tube 3" OD

33880

SL 7-9-18

3.0 D2647 Cap



Comment: Qty.: 1.0000 Each(s)/Unit Total : 1.0000 Each(s)

Pick:

Qty Part Number

Description Batch

1 D2647

Fwd Cap

329328

BE 07-9-29

4.0 LANDING GEAR 1 LANDING GEAR RESOURCE 1



Comment: LANDING GEAR RESOURCE 1

1-Deburr Fwd edge of tube

2-Remove ridge on inside of Fwd edge of tube as per Dwg D2650

3-Weld Fwd Cap as per Dwg D2650. Use aluminum rod. Grind D2647 to fit as required.

A/R Aluminum Rod

m 105138

BE 7-9-29

4-Grind weld flush to cap on top surface only.

BE 7-9-29

SL 7-9-18

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

Date: Wednesday, 9/12/2007 11:49:27 AM

User: Kim Johnston

Process Sheet

Customer: CU-DAR001 Dart Helicopters Services

Drawing Name: 206 L HIGH GEAR SKIDTUBE

Job Number: 34560A

Part Number: D206642441

Job Number:



Seq. #:

Machine Or Operation:

Description:

5-Cut aft end 138.60" from front of tube

6-Drill pilot holes using drill jig DT8025 & DT8169 (A,B,C,D). Open to Ø0.312".

7-Drill holes for wearplates using DT 8028-7. Open to Ø 0.297".

8-Open using #6 Drill Bit

9-Open holes for Tow Ring to Ø0.625" as per Dwg D2650, D2650-7 Drilling Detail

10-Remove inner indexing ridge on aft end of skidtubeas per Dwg D2650

11-Deburr and Blow out all chips form inside the tube

5.0

HAND FINISHING1

HAND FINISHING RESOURCE #1



Comment: HAND FINISHING RESOURCE #1

Chemical Conversion Coat as per QSI 005 4.1

6.0

D26547

206 I Beam (Web)



Comment: Qty.: 1.0000 Each(s)/Unit Total : 1.0000 Each(s)

Pick:

Qty Part Number

Description

Batch

1 D2654-7

Web

B34594

7.0

LANDING GEAR 1

LANDING GEAR RESOURCE 1



Comment: LANDING GEAR RESOURCE 1

1-Open holes to finished size as per Dwg D2650, D2650-7 Drilling Detail (without cutting fluid)

2-Countersink crossbolt spacer holes as per Dwg D2650(without cutting fluid)

3-Deburr. Blow out chips. Grind alodine off around crossbolt spacer.

4-Bond D2654-7 web in place as per QSI 015Ensure holes line upAllow 12 Hrs. cure time before cutting

Start Date: 2-8-4 Time: 2:15 PM

Finish Date: 2/10/05 Time: 7:20 AM

A/R Sikaflex-291 M105586

Sikaflex expiry date: 8-2-1

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

Date: Wednesday, 9/12/2007 11:49:27 AM
User: Kim Johnston

Process Sheet

Customer: CU-DAR001 Dart Helicopters Services

Drawing Name: 206 L HIGH GEAR SKIDTUBE

Job Number: 34560A

Part Number: D206642441

Job Number:



Seq. #:

Machine Or Operation:

Description :

8.0

QC5

INSPECT WORK TO CURRENT STEP



Comment: INSPECT WORK TO CURRENT STEP

E 07/10/05

9.0

D2649

Crossbolt Spacer



Comment: Qty.: 23.0000 Each(s)/Unit Total : 23.0000 Each(s)

Pick:

Qty Part Number

Description

Batch

23 D2649

Crossbolt spacer

234612 BE 07/10/10

10.0

LANDING GEAR 1

LANDING GEAR RESOURCE 1



Comment: LANDING GEAR RESOURCE 1

1-Insert cross bolt spacers D2649. Weld as per QSI 004 and Dwg D2650. Remember to back drill each hole to 0.25" before welding the other side. Use aluminum rod.

A/R Aluminum Rod

m 105138 BE 07/10/10

2-Grind welds flush as per Dwg D2650. Masking Tape access to inside of the Skidtube

SL 7-10-12

3-Counterbore 5/16" x 0.750" deep as per Dwg D2650Deburr

H 7-10-16

11.0

D2680041

Nut Plate



Comment: Qty.: 1.0000 Each(s)/Unit Total : 1.0000 Each(s)

Pick:

Qty Part Number

Description Batch

1 D2680-041

Nut Plate

B 30446 ①

HA 7-10-16

12.0

CCR264SS33

Cherry Rivet



Comment: Qty.: 2.0000 Each(s)/Unit Total : 2.0000 Each(s)

Pick:

Qty Part Number

Description Batch

2 CCR264SS3-3

Rivets

m 103525 ②

H 7-10-16

13.0

M7885343

Rivet



Comment: Qty.: 2.0000 Each(s)/Unit Total : 2.0000 Each(s)

Pick:

Qty Part Number

Description Batch

Dart Aerospace Ltd

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

Date: Wednesday, 9/12/2007 11:49:27 AM
User: Kim Johnston

Process Sheet

Customer: CU-DAR001 Dart Helicopters Services

Drawing Name: 206 L HIGH GEAR SKIDTUBE

Job Number: 34560A

Part Number: D206642441

Job Number:



Seq. #:

Machine Or Operation:

Description :

2 M7885/3-4-3

Rivets

M22515 (2) K 7-10-16

14.0

HAND FINISHING1

HAND FINISHING RESOURCE #1



Comment: HAND FINISHING RESOURCE #1

Install D2680-041 Nut Plate as per Dwg D2650

M 7-10-16

15.0

QC9

VISUAL WELDING INSPECTION



Comment: VISUAL WELDING INSPECTION

PD 07-10-17

16.0

QC5

INSPECT WORK TO CURRENT STEP



Comment: INSPECT WORK TO CURRENT STEP

07-10-17

17.0

HAND FINISHING1

HAND FINISHING RESOURCE #1



Comment: HAND FINISHING RESOURCE #1

Pressure wash as per QSI 005

M-L

07/10/30

(1X)

18.0

POWDER COATING

POWDER COATING



Comment: POWDER COATING

Powder Coat White (Ref. 4.3.5.1) as per QSI 005 4.3

Make sure Nut Plate Thread protected use paint screw

M105914

HR

07-10-30

(2)

19.0

QC3

INSPECT POWDER COAT/CHEMICAL CONVERSION



Comment: INSPECT POWDER COAT/CHEMICAL CONVERSION

FL

07/10/31

(1)

20.0

D26483

Wearpad



Comment: Qty.: 6.0000 Each(s)/Unit Total: 6.0000 Each(s)

Pick:

Qty Part Number

Description Batch

6 D2648-3

Wearpad

B34591

FL

21.0

D265615

Wearplate



Comment: Qty.: 1.0000 Each(s)/Unit Total: 1.0000 Each(s)

Pick:

Qty Part Number

Description Batch

1 D2656-15

Wearshoe

B32579

FL

07/10/31

(1)

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

Date: Wednesday, 9/12/2007 11:49:27 AM

User: Kim Johnston

Process Sheet

Customer: CU-DAR001 Dart Helicopters Services

Drawing Name: 206 L HIGH GEAR SKIDTUBE

Job Number: 34560A

Part Number: D206642441

Job Number:



Seq. #:

Machine Or Operation:

Description :

22.0

D265623

Wearplate



Comment: Qty.: 1.0000 Each(s)/Unit Total : 1.0000 Each(s)

Pick:

Qty Part Number

Description Batch

1 D2656-23

Wearshoe

B34171

FL

23.0

D265637

Wearplate



Comment: Qty.: 1.0000 Each(s)/Unit Total : 1.0000 Each(s)

Pick:

Qty Part Number

Description Batch

1 D2656-37

Wearshoe

B34510

FL

24.0

D34291



Comment: Qty.: 1.0000 Each(s)/Unit Total : 1.0000 Each(s)

Pick:

Qty Part Number

Description Batch

1 D3429-1

Wearpad

B34012

FL

25.0

ALS41032130

Insert



Comment: Qty.: 60.0000 Each(s)/Unit Total : 60.0000 Each(s)

Pick:

Qty Part Number

Description Batch

60 ALS4-1032-130

Inserts

M105729

or (see QSI 017)

FL

26.0

AN960JD10L

Washer



Comment: Qty.: 60.0000 Each(s)/Unit Total : 60.0000 Each(s)

Pick:

Qty Part Number

Description Batch

60 AN960JD10L

Washer

M104374

FL 07/10/31

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

Date: Wednesday, 9/12/2007 11:49:27 AM
User: Kim Johnston

Process Sheet

Customer: CU-DAR001 Dart Helicopters Services

Drawing Name: 206 L HIGH GEAR SKIDTUBE

Job Number: 34560A

Part Number: D206642441

Job Number:



Seq. #:

Machine Or Operation:

Description :

27.0

MS27039108

Screw



Comment: Qty.: 60.0000 Each(s)/Unit Total : 60.0000 Each(s)

Pick:

Qty Part Number

Description Batch

60 MS27039-1-08

Screw

M104547

FL

28.0

D26511

Plug



Comment: Qty.: 22.0000 Each(s)/Unit Total : 22.0000 Each(s)

Pick:

Qty Part Number

Description Batch

22 D2651-1

Plugs

B33349

FL

29.0

D26513

O-Ring



Comment: Qty.: 22.0000 Each(s)/Unit Total : 22.0000 Each(s)

Pick:

Qty Part Number

Description Batch

22 D2651-3

O-Rings

B33087

FL

30.0

AN960JD416

Washer



Comment: Qty.: 1.0000 Each(s)/Unit Total : 1.0000 Each(s)

Pick:

Qty Part Number

Description Batch

1 AN960JD416

Washer

M105426

FL

31.0

MS27039406

Screw



Comment: Qty.: 1.0000 Each(s)/Unit Total : 1.0000 Each(s)

Pick:

Qty Part Number

Description Batch

1 MS27039-4-06

Screw

M15194

FL

32.0

D2646

Aft Cap



Comment: Qty.: 1.0000 Each(s)/Unit Total : 1.0000 Each(s)

Pick:

Qty Part Number

Description Batch

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

Date: Wednesday, 9/12/2007 11:49:27 AM
User: Kim Johnston

Process Sheet

Customer: CU-DAR001 Dart Helicopters Services

Drawing Name: 206 L HIGH GEAR SKIDTUBE

Job Number: 34560A

Part Number: D206642441

Job Number:



Seq. #:

Machine Or Operation:

Description :

1 D2646

Aft Cap

B 31335

FZ

33.0

AN960JD10L

Washer



Comment: Qty.: 2.0000 Each(s)/Unit Total : 2.0000 Each(s)

Pick:

Qty Part Number

Description Batch

2 AN960JD10L

Washer

~~M10454~~

M104374

FZ

34.0

MS27039108

Screw



Comment: Qty.: 2.0000 Each(s)/Unit Total : 2.0000 Each(s)

Pick:

Qty Part Number

Description Batch

2 MS27039-1-08

Screw

M104547

FZ

35.0

HAND FINISHING1

HAND FINISHING RESOURCE #1



Comment: HAND FINISHING RESOURCE #1

1-Install inserts & wearpads as per dwg D2922. Use a drop of Sikaflex inside insert holes before installing wearpad/wearplate.

A/R Sikaflex-291

M105585

Sikaflex expiry date:

08-07

2-Install O-Rings D2651-3 on plugs D2651-1 with Petroleum Jelly and install plugs as per Dwg D2650.

Clean excess adhesive

3-Install MS27039-4-06 Screw as per DEO 9153

4-Inspect for foreign object per QSI 024

5-Install D2646 Aft Cap and seal with SikaflexClean excess adhesive

A/R Sikaflex-291

M103585

Sikaflex expiry date:

08-07

6-Wing Walk as per Dwg D2650-7 and QSI 005 4.4

Batch: M106030

FZ
07/10/31 ①

FZ 07/11/01 ①

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: 12 Date: 01/11/86
 QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

Date: Wednesday, 9/12/2007 11:49:27 AM
User: Kim Johnston

Process Sheet

Customer: CU-DAR001 Dart Helicopters Services

Drawing Name: 206 L HIGH GEAR SKIDTUBE

Job Number: 34560A

Part Number: D206642441

Job Number:



Seq. #:

Machine Or Operation:

Description :

36.0

QC5

INSPECT WORK TO CURRENT STEP



Comment: INSPECT WORK TO CURRENT STEP

5 07/11/01

37.0

PACKAGING 1

PACKAGING RESOURCE #1



Comment: PACKAGING RESOURCE #1

Identify and Stock

Location: _____

PPP 34133

6 7/11/02

38.0

QC21

FINAL INSPECTION/W/O RELEASE



1

Comment: FINAL INSPECTION/W/O RELEASE

1 07/11/06

Job Completion



u 07-11-05

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

DART

DESIGN <i>UP</i>	DRAWN BY <i>UP</i>	DART AEROSPACE USA, INC. PORT HADLOCK, WA	
CHECKED <i>PH</i>	APPROVED <i>[Signature]</i>	DRAWING NO. D2650	REV. E SHEET 1 OF 5
DATE 06.03.30		TITLE 206/407 SKIDTUBE ASSEMBLIES SCALE NTS	
A	97.03.25	NEW ISSUE	
B	97.06.26	AS MANUFACTURED CHANGES	
C	97.10.29	CHANGE HOLE PATTERN AND FRONT END	
D	04.05.17	REDRAW; INCORP. DE09136/9153/9163 MOD GROUND HNDLNG ON D2650-1/-3	
E	06.03.30	RMV C'BORE, CHG DRILL, ADD CHAMFER	

RELEASED
06 04 17 *[Signature]*

Qty -1	Qty -3	Qty -5	Qty -7	Part Number	Description
X				D2650-1	SKIDTUBE ASSEMBLY
	X			D2650-3	SKIDTUBE ASSEMBLY
		X		D2650-5	SKIDTUBE ASSEMBLY
			X	D2650-7	SKIDTUBE ASSEMBLY
1	1	1	1	D2600-1-160	EXTRUSION
1				D2654-1	WEB
	1			D2654-3	WEB
		1		D2654-5	WEB
			1	D2654-7	WEB
1	1	1	1	D2646	AFT CAP
1	1	1	1	D2647	CAP
16	17	19	23	D2649	CROSS BOLT SPACER
16	18	14	22	D2651-1	PLUG
16	18	14	22	D2651-3	O-RING
1	1	1	1	D2680-041	NUT PLATE
2	2			D3286-1	DOUBLER
2	2			D3286-3	STUD
42	44	54	60	ALS7-1032-130	INSERT (or AKS4-1032-130, ALS4-1032-130, ALS7-1032-130)
2	2	2	2	AN960JD10L	WASHER
2	2	2	2	CCR264SS3-3	RIVET
2	2	2	2	CR3212-4-03	RIVET
2	2	2	2	MS27039-1-08	SCREW
1	1	1	1	MS27039-4-06	SCREW
1	1	1	1	AN960JD416	WASHER
52	52			CR3212-4-04	RIVET




NOTES

- WELD PER DART QSI 004
- DAMAGE TOLERANCE ON FWD BEND:
THERE SHOULD BE NO VISIBLE WRINKLES IN THE BEND FROM THE GROUND TO A HEIGHT OF 5 INCHES ABOVE THE GROUND. IT IS ACCEPTABLE TO POLISH OUT GOUGES UP TO 0.020 DEEP IN THE BENT PORTION OF THE TUBE. A MAXIMUM REDUCTION IN DIAMETER OF 0.150" IS ACCEPTABLE IN THE BENT PORTION OF THE TUBE.
- BOND WEB INTO OUTER TUBE WITH SIKAFLEX-241/-291 ADHESIVE PER DART QSI 015
- INSERT D2651-1 PLUG C/W D2651-3 O-RING IN HOLES MARKED 'P' (BOTH SIDES OF TUBE)
- FINISH: -CHEMICAL CONVERSION COAT PER DART QSI 005 4.1
-POWDER COAT WHITE (4.3.5.1) PER DART QSI 005 4.3
-BLACK ANTI-SKID PAINT AS INDICATED TO 0.5 ABOVE LOCATION RIDGE PER DART QSI 005 4.4
- DRILL Ø0.297 FOR ALS7-1032-130 INSERTS USING TEMPLATE DT8056-1 ON -1 TUBE, DT8056-3 ON -3 TUBE, DT8056-5 ON -5 TUBE, AND DT8056-7 ON -7 TUBE. INSTALL INSERTS AFTER FINISH.
- TOLERANCES ARE PER DART QSI 018 UNLESS OTHERWISE NOTED

SHOP COPY
RETURN TO
ENGINEERING
UNCONTROLLED COPY
SUBJECT TO AMENDMENT
WITHOUT NOTICE
WORK ORDER
NO. 34560A

Copyright © 1997 by DART AEROSPACE USA, INC.



THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE USA, INC.

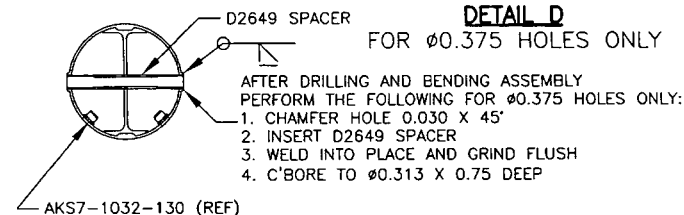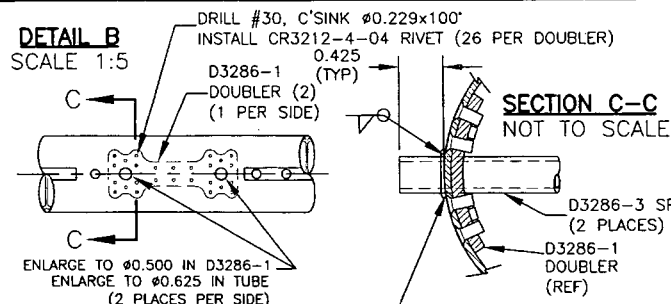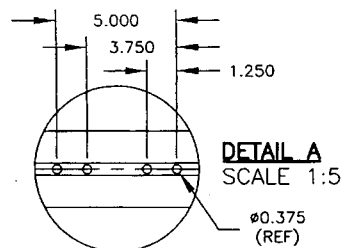

RELEASED

06-04-07


- TO INSTALL D3286-1/-3:
1. GRIND OFF FLANGE IN AREA SHOWN, FLUSH WITH ROUND TUBE
 2. LOCATE & DRILL D3286-1 DOUBLER USING DT3286-1T1
 3. ENLARGE HOLES IN D3286-1 TO 0.500
 4. ENLARGE HOLES IN TUBE TO 0.625 AND CHAMFER HOLE 0.030x45
 5. RIVET D3286-1 TO TUBE
 6. INSERT D3286-3 SPACER
 7. WELD IN PLACE AND GRIND FLUSH

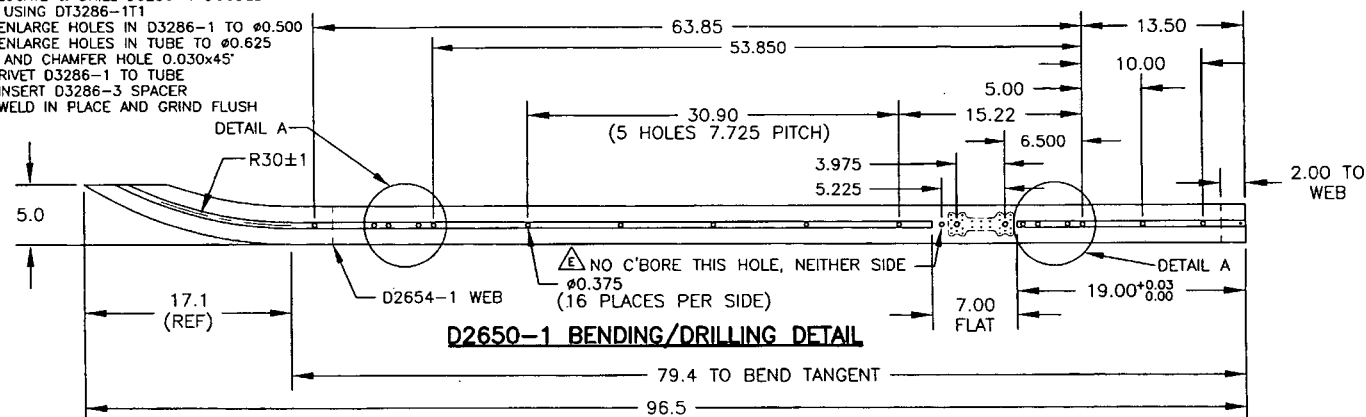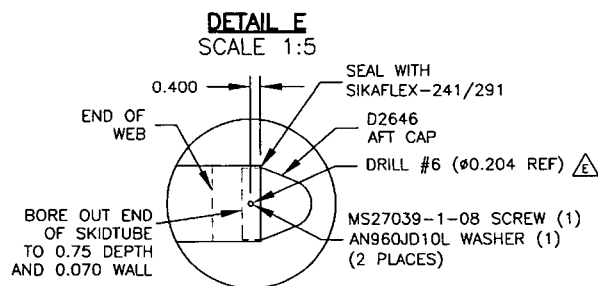


DETAIL F (NOT TO SCALE)

1. CUT TUBE LEVEL
2. REMOVE RIDGE ON FWD SIDE
3. LOCATE D2647 (TRIM AS NECESSARY)
4. WELD D2647 IN PLACE PER DART QSI 004
5. GRIND FLUSH
6. RIVET D2680-041 NUT PLATE IN PLACE

 NOTE: MASK THREADS IN D2680-041 PRIOR TO FINISH



REMOVE RIDGE ON INSIDE OF SKIDTUBE LEAVE 0.070 MIN.


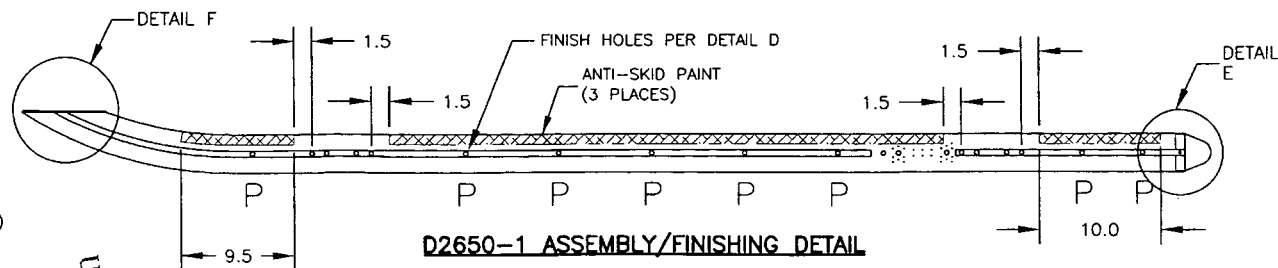


COPYRIGHT © 2004 BY DART AEROSPACE USA, INC.


THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE USA, INC.

DESIGN	CP	DRAWN BY	CP	DART DART AEROSPACE USA, INC. PORT HADLOCK, WA
CHECKED	PH	APPROVED	H	DRAWING NO. D2650
DATE	06.03.30	TITLE	SKIDTUBE	REV. E SHEET 2 OF 5
				SCALE 1:10

NO. 54560A
WORK ORDER
UNCONTROLLED COPY
SUBJECT TO AMENDMENT
WITHOUT NOTICE
SHOP COPY
RETURN TO
ENGINEERING

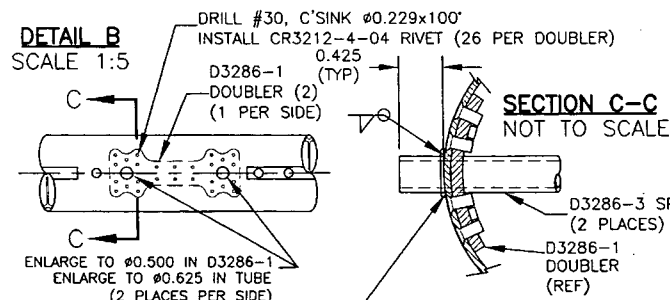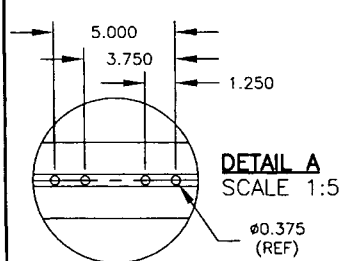


SECTION C-C NOT TO SCALE

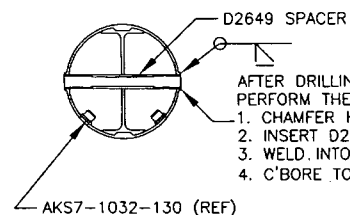


- AFTER DRILLING AND BENDING ASSEMBLY
PERFORM THE FOLLOWING FOR 0.375 HOLES ONLY:
1. CHAMFER HOLE 0.030 X 45°
 2. INSERT D2649 SPACER
 3. WELD INTO PLACE AND GRIND FLUSH
 4. C'BORE TO 0.313 X 0.75 DEEP

RELEASED

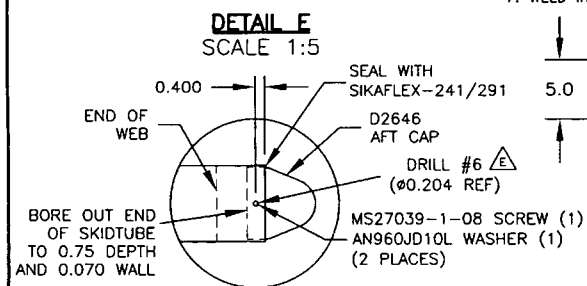


- TO INSTALL D3286-1/-3:
1. GRIND OFF FLANGE IN AREA SHOWN, FLUSH WITH ROUND TUBE
 2. LOCATE & DRILL D3286-1 DOUBLER USING DT3286-1T1
 3. ENLARGE HOLES IN D3286-1 TO 0.500
 4. ENLARGE HOLES IN TUBE TO 0.625 AND CHAMFER HOLE 0.030 X 45°
 5. RIVET D3286-1 TO TUBE
 6. INSERT D3286-3 SPACER
 7. WELD IN PLACE AND GRIND FLUSH

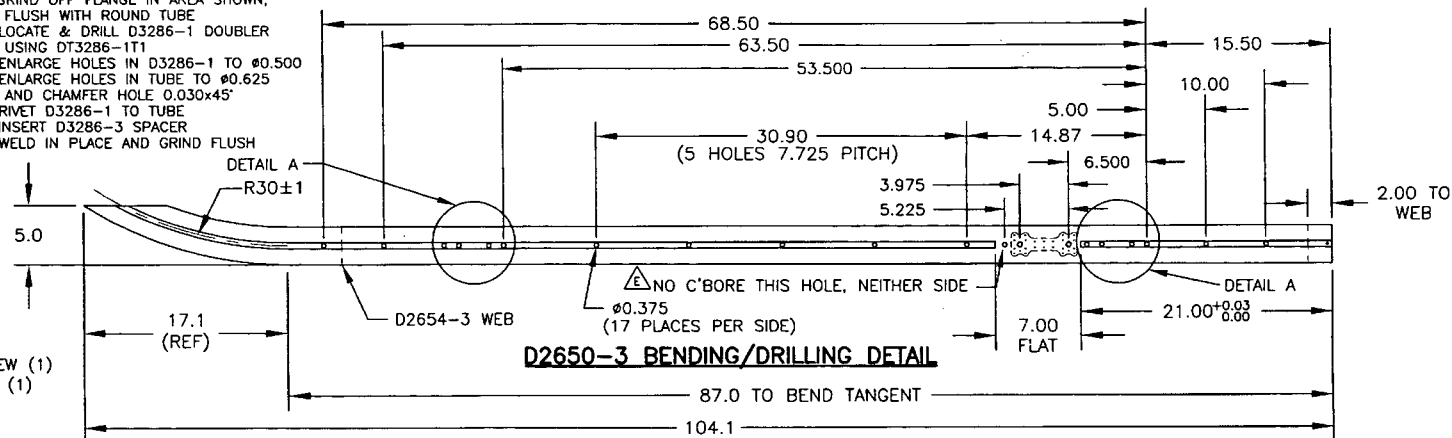


DETAIL F (NOT TO SCALE)

1. CUT TUBE LEVEL
2. REMOVE RIDGE ON FWD SIDE
3. LOCATE D2647 (TRIM AS NECESSARY)
4. WELD D2647 IN PLACE PER DART QSI 004
5. GRIND FLUSH
6. RIVET D2680-041 NUT PLATE IN PLACE

 NOTE: MASK THREADS IN D2680-041 PRIOR TO FINISH



REMOVE RIDGE ON INSIDE OF SKIDTUBE LEAVE 0.070 MIN.



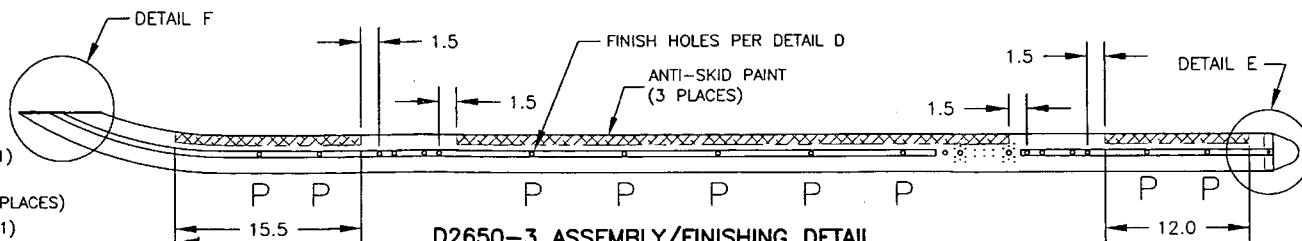


NO. 345600A
WORK ORDER
SUBJECT TO AMENDMENT
WITHOUT NOTICE
UNCONTROLLED COPY
ENGINEERING
RETURN TO
SHOP COPY

COPYRIGHT © 2004 BY DART AEROSPACE USA, INC.



THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE USA, INC.

DESIGN	UP	DRAWN BY	UP	DART DART AEROSPACE USA, INC.	REV. E
CHECKED	PH	APPROVED	PH	PORT HADLOCK, WA	SHEET 3 OF 5
DATE	06.03.30	TITLE	SKIDTUBE	SCALE	1:10

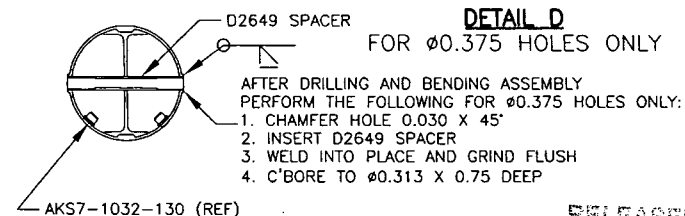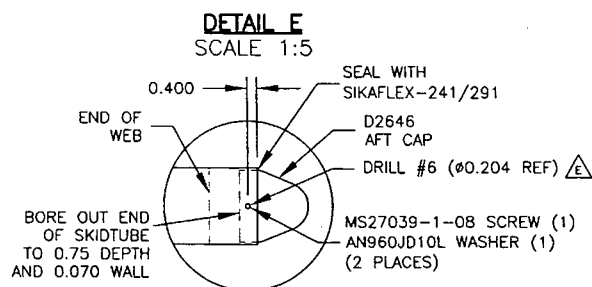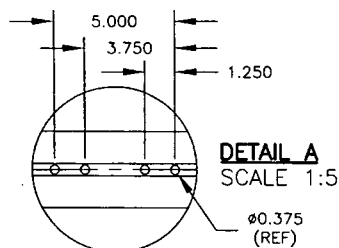

RELEASED


06.03.30

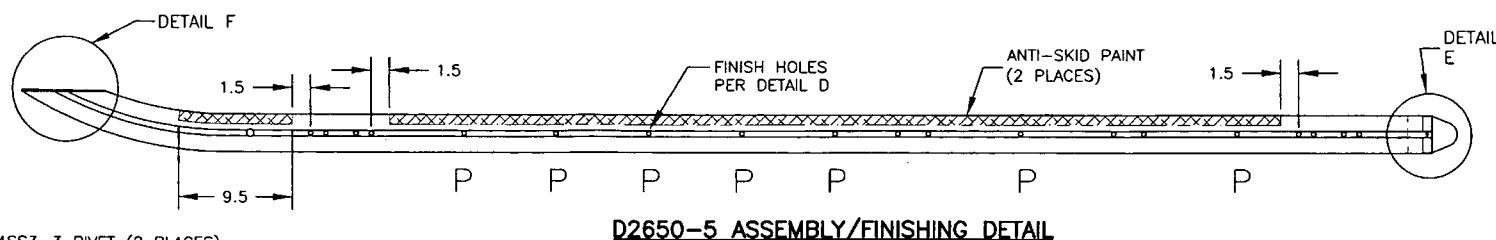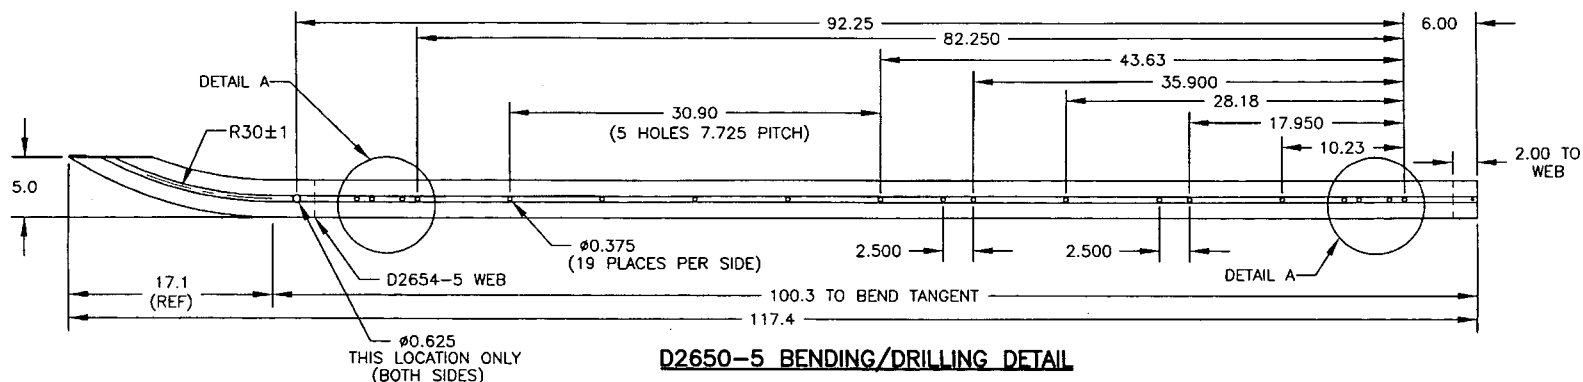

DETAIL F (NOT TO SCALE)

- CUT TUBE LEVEL
- REMOVE RIDGE ON FWD SIDE
- LOCATE D2647 (TRIM AS NECESSARY)
- WELD D2647 IN PLACE PER DART QSI 004
- GRIND FLUSH
- RIVET D2680-041 NUT PLATE IN PLACE

 NOTE: MASK THREADS IN D2680-041 PRIOR TO FINISH









REMOVE RIDGE ON INSIDE OF SKIDTUBE LEAVE 0.070 MIN.

NO. 15604
WORK ORDER
SUBJECT TO AMENDMENT
WITHOUT NOTICE
UNCONTROLLED COPY
ENGINEERING
RETURN TO
SHOP COPY

COPYRIGHT © 2004 BY DART AEROSPACE USA, INC.

THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE USA, INC.

DESIGN	DRAWN BY	DART DART AEROSPACE USA, INC. PORT HADLOCK, WA	REV. E
CHECKED	APPROVED	DRAWING NO. D2650	SHEET 4 OF 5
DATE	TITLE	SKIDTUBE	SCALE 1:10
06.03.30			

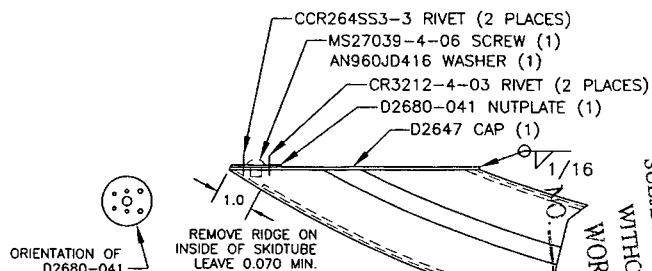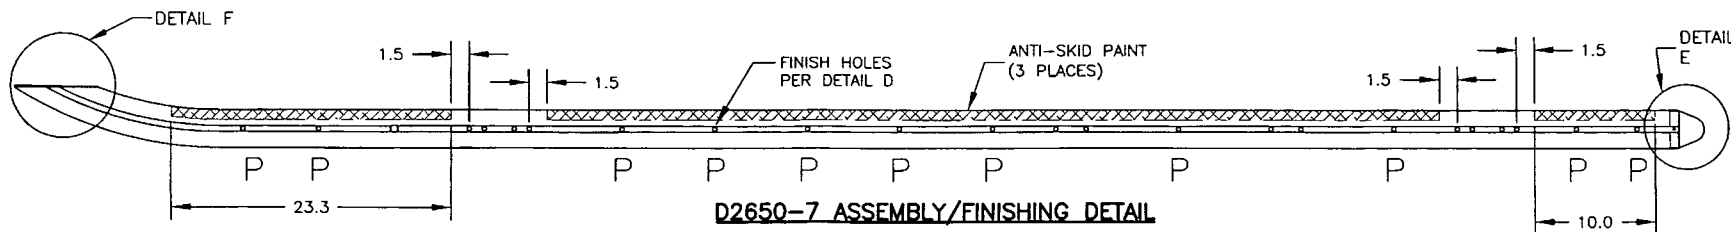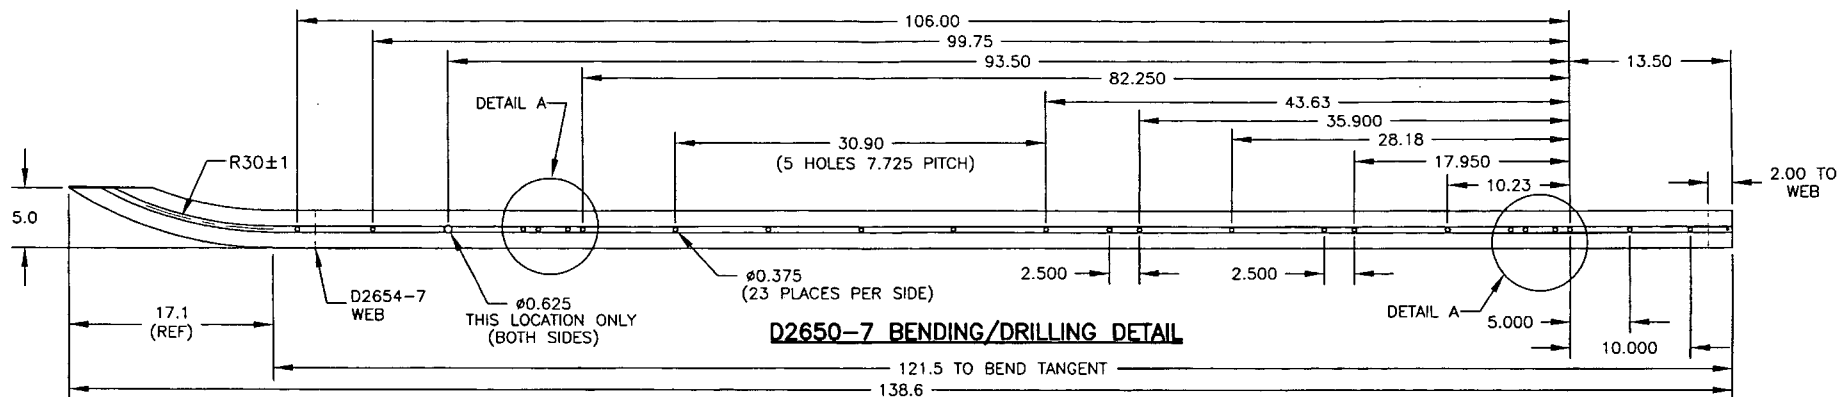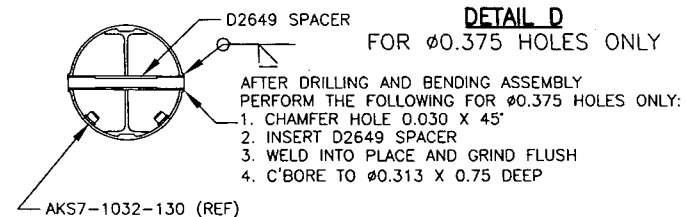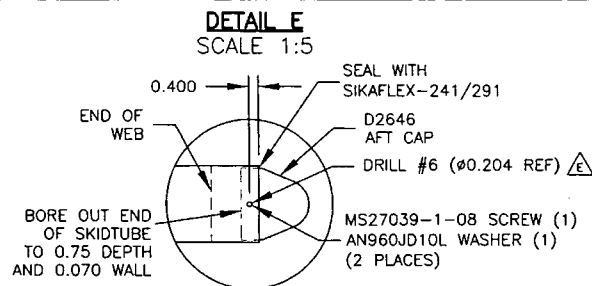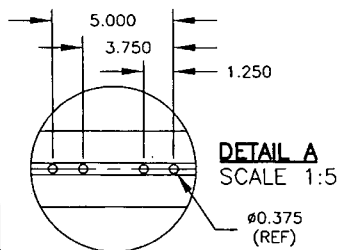

DETAIL F (NOT TO SCALE)

1. CUT TUBE LEVEL
2. REMOVE RIDGE ON FWD SIDE
3. LOCATE D2647 (TRIM AS NECESSARY)
- WELD D2647 IN PLACE PER DART QSI 004
- GRIND FLUSH
- RIVET D2680-041 NUT PLATE IN PLACE

NOTE: MASK THREADS IN D2680-041 PRIOR TO FINISH

WORK ORDER 315604
SUBJECT TO AN AMENDMENT
WITHOUT NOTICE
CONTROLLED COPY
ENGINEERING
RETURN TO
TOP COPY

COPYRIGHT © 2004 BY DART AEROSPACE USA, INC.

THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE USA, INC.

DESIGN	44	DRAWN BY	44	DART DART AEROSPACE USA, INC. PORT HADLOCK, WA	REV. E
CHECKED	44	APPROVED	44	DRAWING NO. D2650	SHEET 5 OF 5
DATE	06.03.30	TITLE	SKIDTUBE	SCALE	1:10

RELEASED
06.03.30

NO. 128

AWS D17.1.2001 QUALIFICATION TEST RECORD

Name Barclay Elliott
Joint Welding Procedure tig
Part number and Job number D200 640 541 / B 34523 A

TEST WELDS REQUIRED

BASE METAL Aluminium WELDING PROCESS tig
Penetration Complete ☐ Partial ☒ Single Weld ☒ Double Weld ☐
Current AC ☒ DC ☐ Backing YES ☐ NO ☒
Position Vertical Down ☐ Up ☐
Sheet Groove 1G ☐ 2G ☐ 3G ☐ 4G ☐
Tube Groove 1G ☐ 2G ☐ 5G ☐ 6G ☐
Short Fillet 1F ☐ 2F ☐ 3F ☐ 4F ☐
Tube Fillet 1F ☐ 2F ☐ 4F ☐ 5F ☐
Crossbolt Spacer Welded into Skid tube

TEST RESULTS

Visual Pass ☒ Fail ☐
Penetration Pass ☒ Fail ☐
Crossbolt Spacer Pass ☒ Fail ☐

The above named individual is qualified in accordance with AWS D17.1.2001 to weld

Date of Test Coupon 07-09-26 Qualifier P. D. J.